



STEP 1: SLIDE THE REMOVABLE PINS DOWN OVER THE DOWEL PINS ON THE BASE PLATE. THE REMOVABLE PINS MUST SLIDE FREELY OVER THE DOWELS. SLOWLY AND CAREFULLY LOWER THE PLATFORM DOWN INTO THE PIT. KEEP THE PLATFORM LEVEL. THE REMOVABLE PINS MUST ALL PASS THROUGH THE CENTER HOLES IN THE CAPTURE BLOCKS.

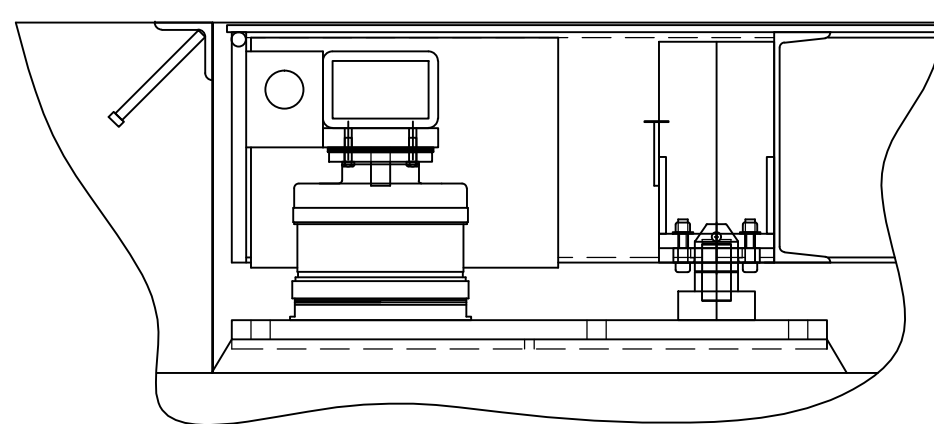


STEP 2: LOWER THE PLATFORM ALL THE WAY DOWN ONTO THE LOAD CELL. VISUALLY CONFIRM THAT THE LOAD CELL HEAD IS SEATED SQUARELY IN THE CENTERING RING.

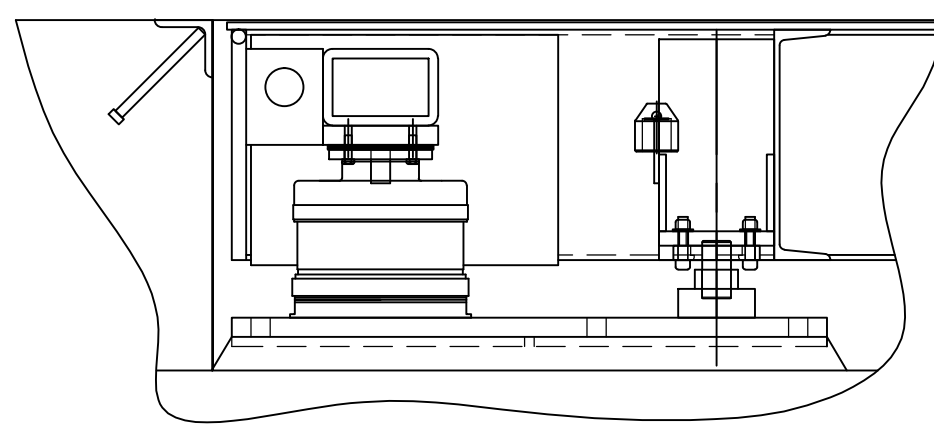


STEP 3: PULL THE REMOVABLE PIN UP THROUGH THE CAPTURE BLOCK AND STORE IT ON THE POST PROVIDED. THE SCALE IS READY FOR RECALIBRATION (AT THE DIGITAL INDICATOR).




DECK RE-POSITIONING PROCEDURE (AFTER INITIAL INSTALLATION)
SCALE 1:10

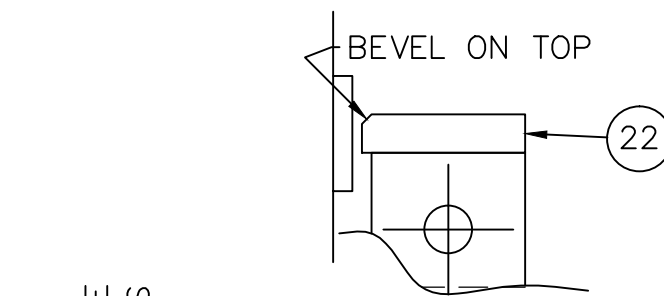


SECTION D-D
SCALE 1:5

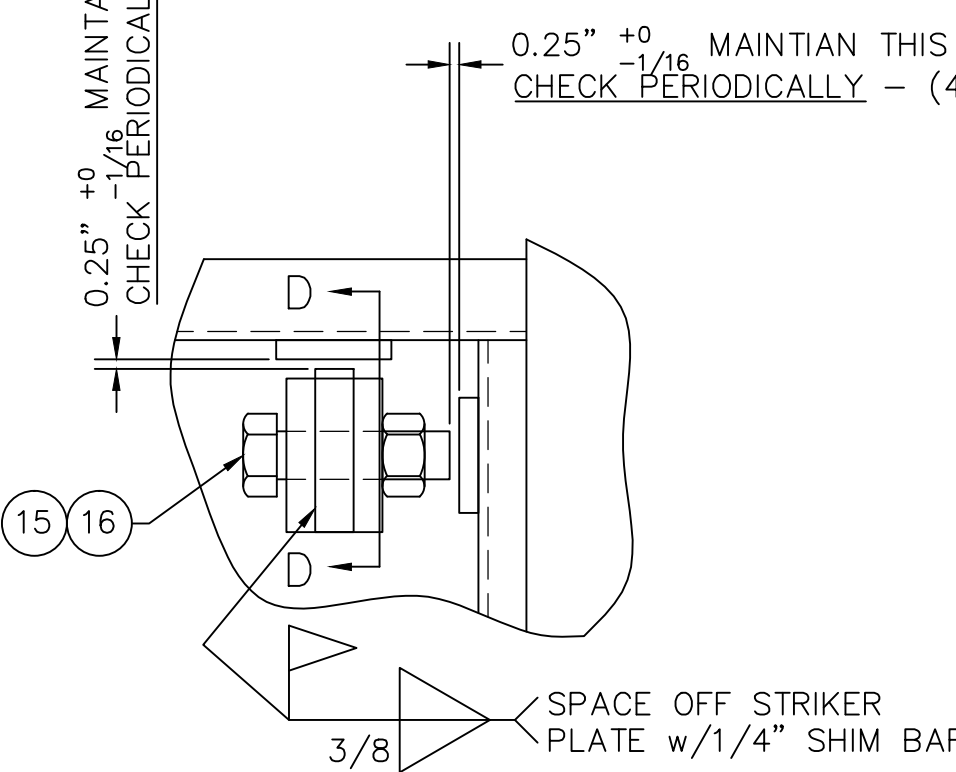

DETAIL A
SCALE 1:5

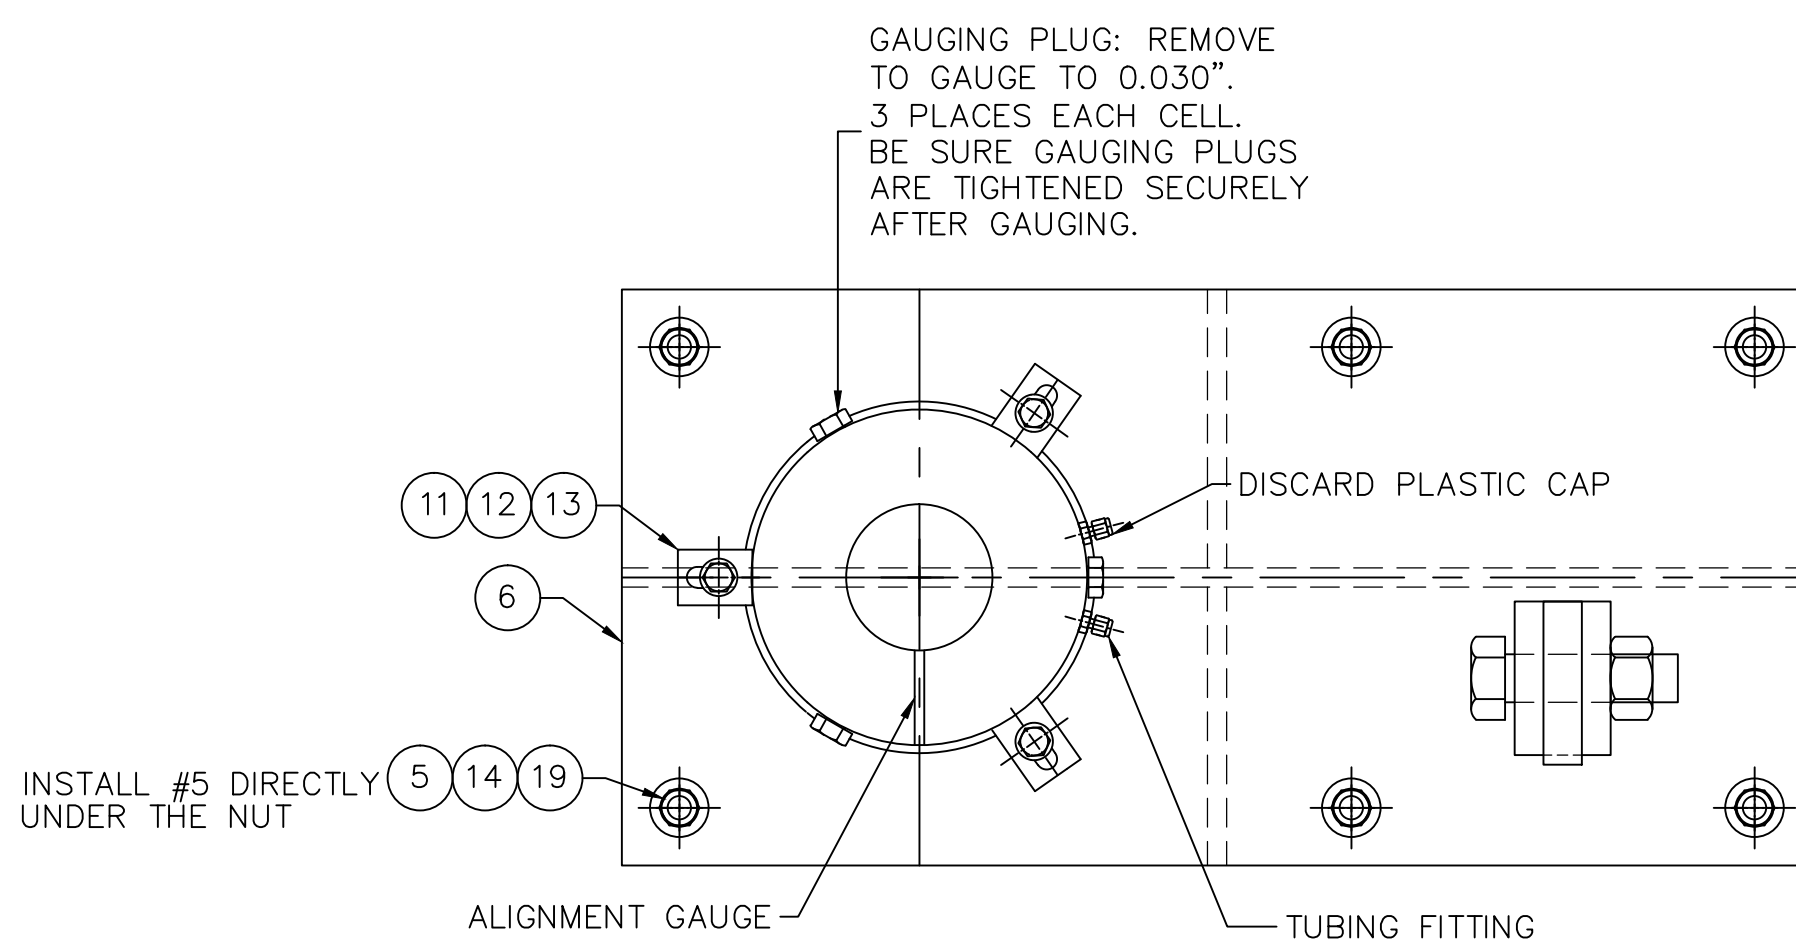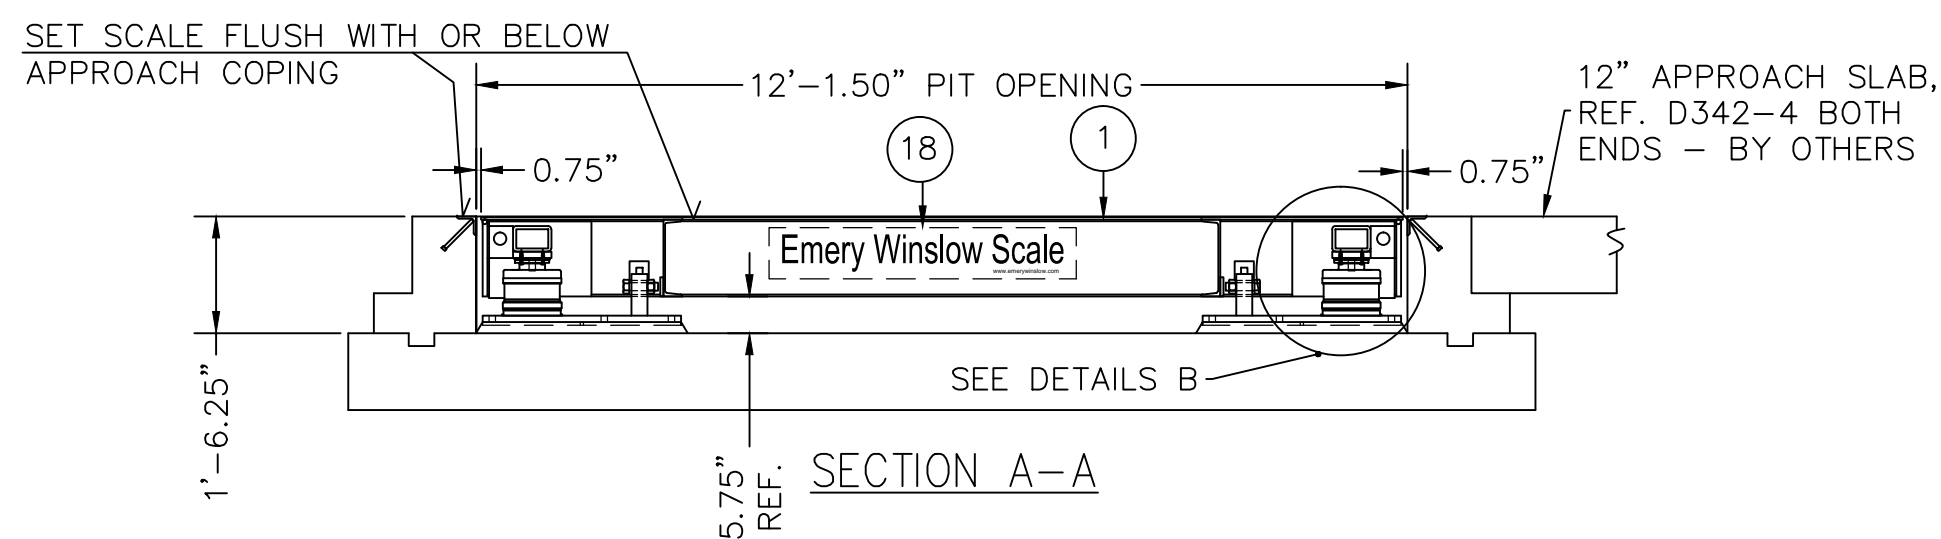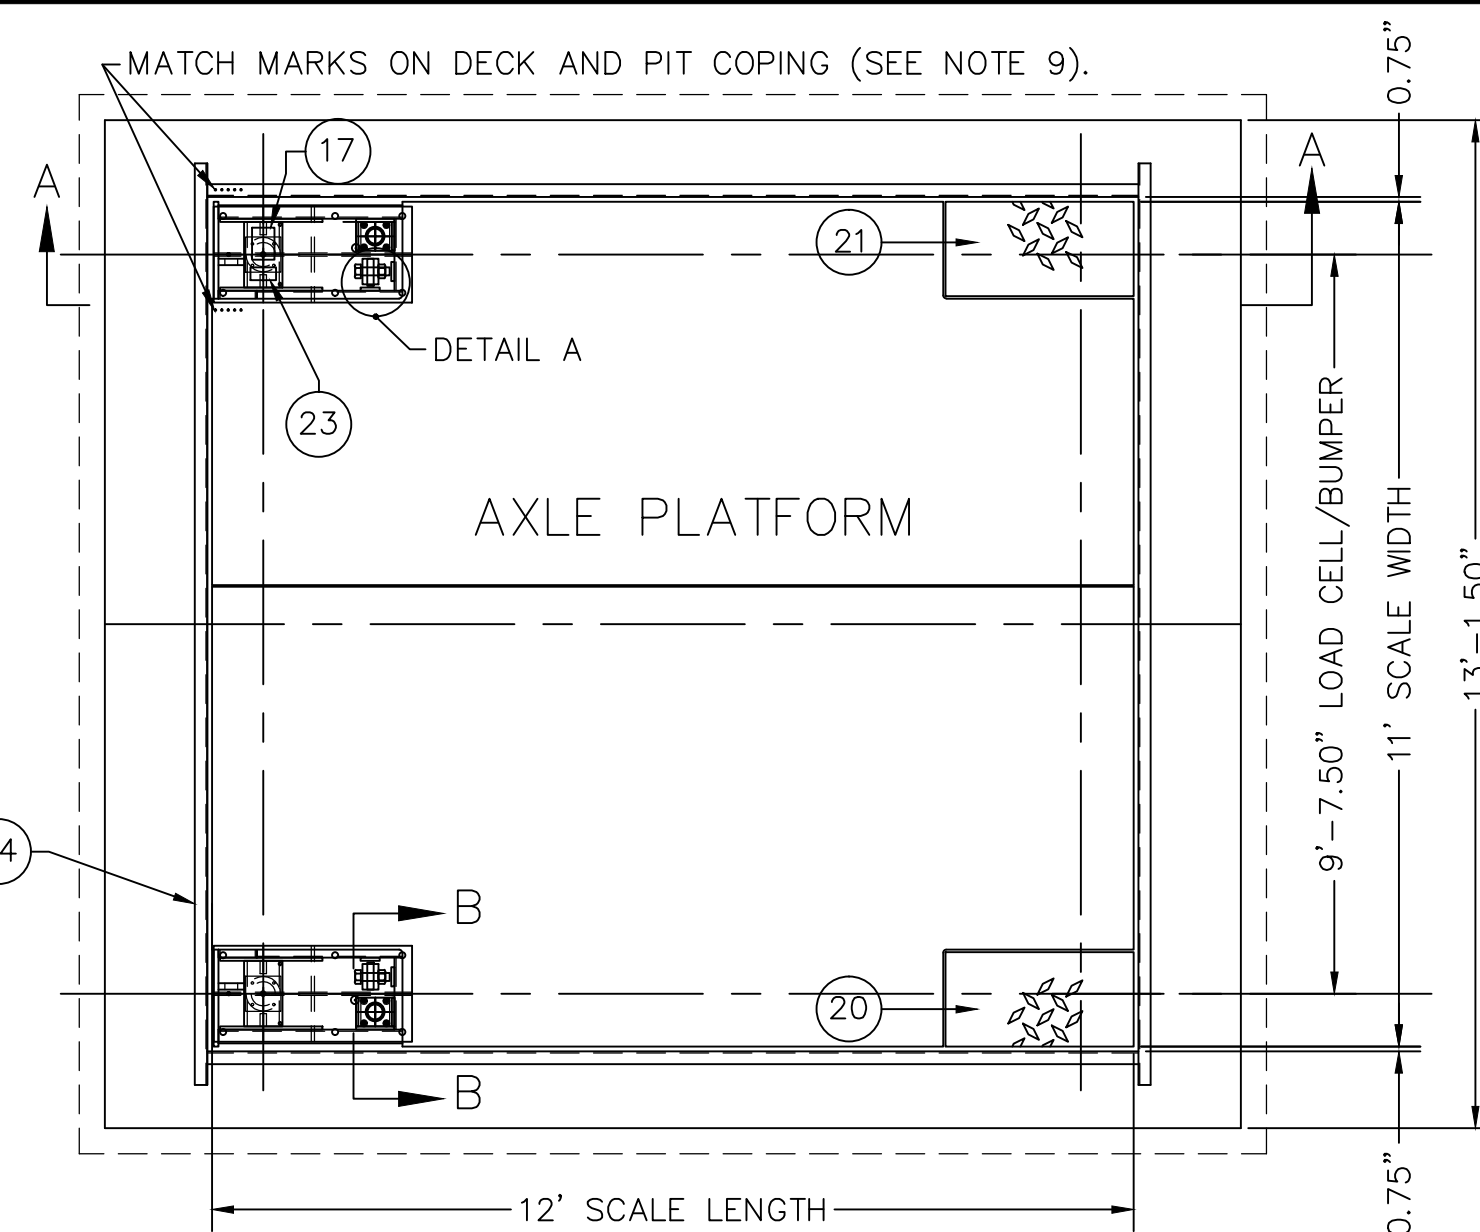


TYPICAL TOP VIEW OF CELL ON BASE PLATE
SCALE 1:5

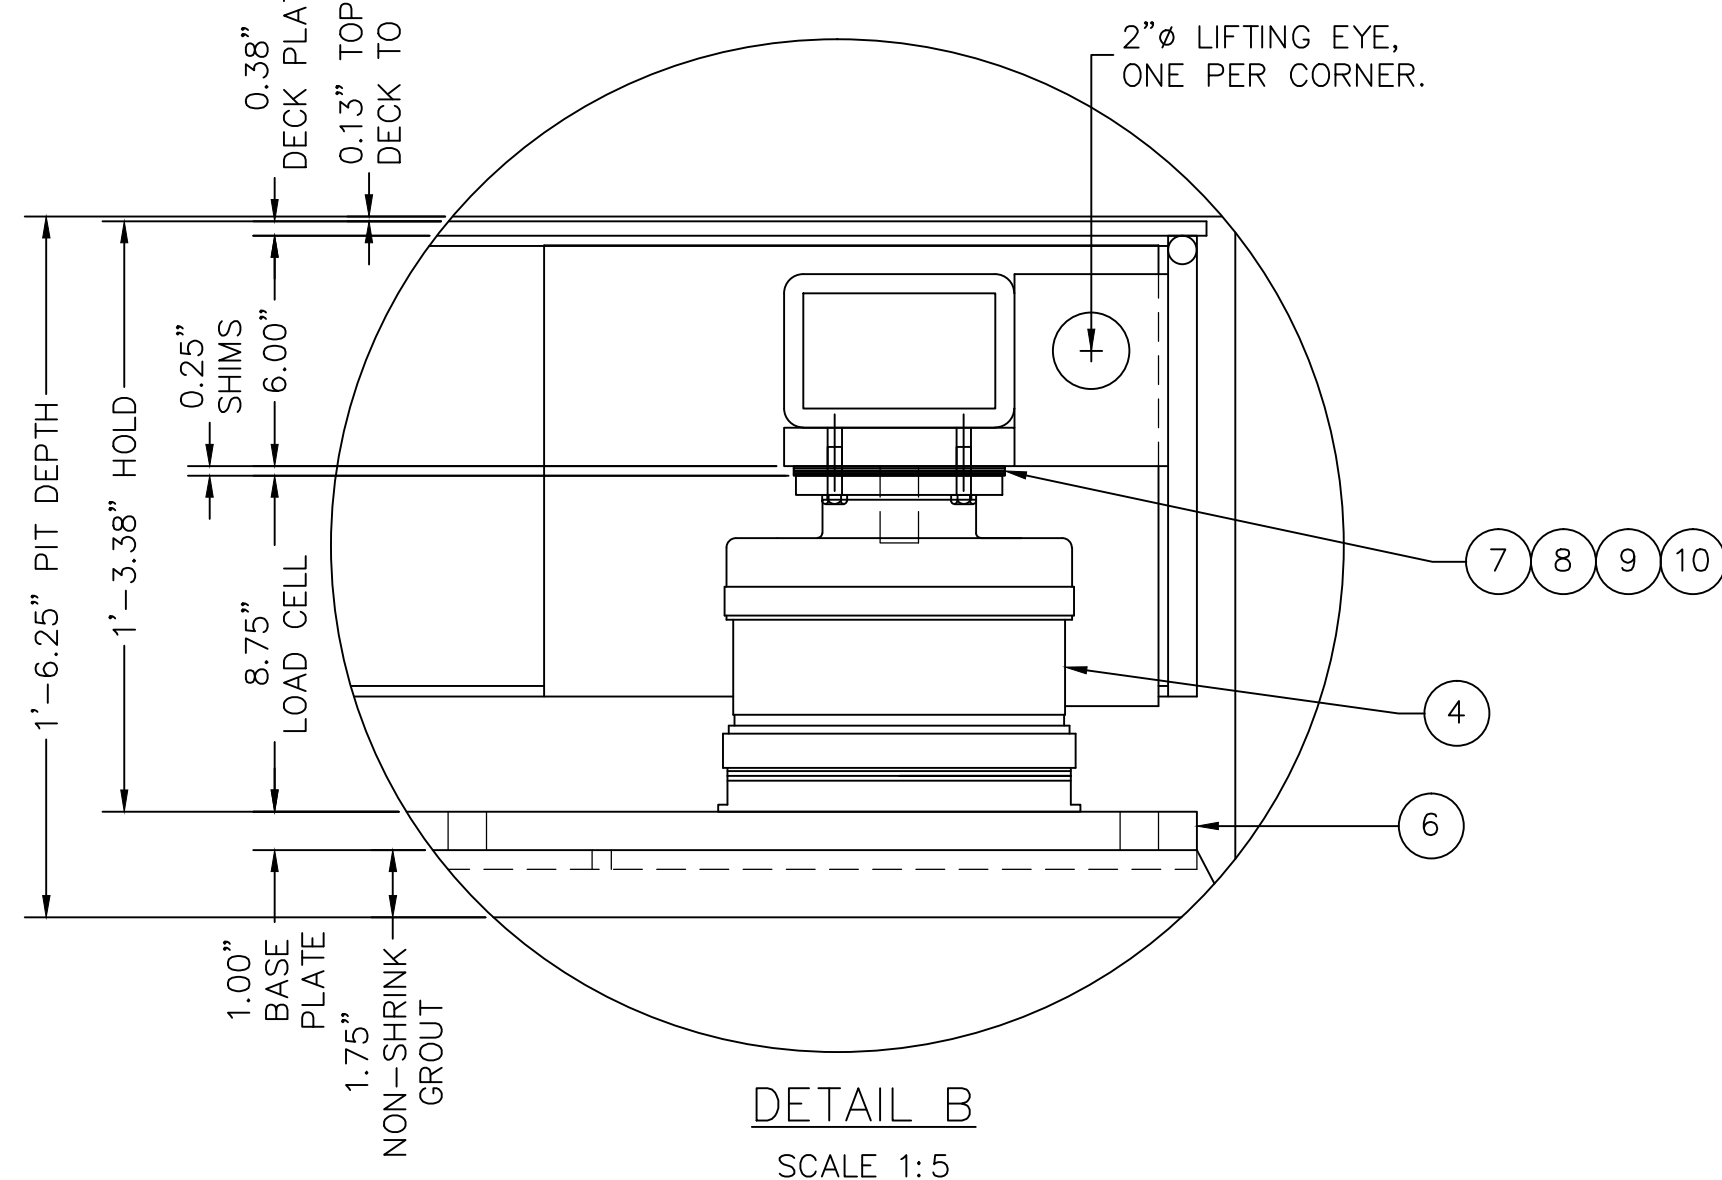

DETAIL B
SCALE 1:5

ITEM NO.	DESCRIPTION	QTY	MATERIAL	UNIT WT.	PART NO.	SIZE	WT.
1	AXLE PLATFORM	1	SEE ASS'Y	5803.0	D-75430		5803
2	ALIGNMENT PIN ASS'Y	4	SEE ASS'Y	15.50	B-72887-B		62
3	CAPTURE BLOCK ASS'Y	4	SEE ASS'Y	-	B-72888-G		-
4	LOAD CELL	4	SEE ASS'Y	63.00	D-29547-2	136-75-CH; NTEP NP. 88-239-P	252
5	LOCK WASHER	24	SS	-		FOR 0.75"	-
6	BASE PLATE	4	ASTM A36	154.00	B-72875-B,-1-B, L.H. AND R.H. PLATES REQUIRED		616
7	CENTERING RING	4	A/R	1.50	B-72884-B		6
8	SHIM	12	SS	0.50	A-29869-1-G	0.06 THICK	6
9	SHIM	8	SS	0.30	A-29869-2-G	0.03 THICK	3
10	HHCS	16	SS	-		0.375-13UNC X 1.25	-
11	CLAMP	12	SS	-	A-74818		-
12	HHCS	12	SS	-		0.50-13UNC X 1.25	-
13	MS FLAT WASHER	12	SS	-		FOR 0.500", ONE PER CLAMP	-
14	CHEM-STUD W/NUT & WASHER	24	CS ZN PL	-	B-72877-B	0.75 X 12.00	-
15	HHCS	4	GR. 8	-		1.25-7UNC X 4.50 FULL THREAD, ZN PL	-
16	TRI-LOCK NUT	4	GR. 2H	-		1.25-7UNC, ZN PL	-
17	SERIAL NUMBER PLATE	1	SS	-	B-34821-E		-
18	EWSCO DECAL	2	-	-	A-70894-A	8.00 X 48.00	-
19	CHEM-STUD CAPSULE	24	-	-	256702 HILTI OR EQ. HVU	0.75 X 6.63	-
20	COVER RIGHT	2	ASTM A36	72.00	B-73364-1-B (MATCH MARKED TO HATCH)		144
21	COVER, LEFT	2	ASTM A36	72.00	B-73364-B (MATCH MARKED TO HATCH)		144
22	TRANSVERSE BUMPER	4	ASTM A36	-	A-72883 (1.00 X 1.00 X 4.00)		-
23	PATENT NO. TAG	1	SS	-	A-74289-B		-
24	APPROACH COPING	2	SEE ASSY	91.00	B-36119-A		182

ANTI-SIEZE ON INTERNAL AND EXTERNAL THREADS

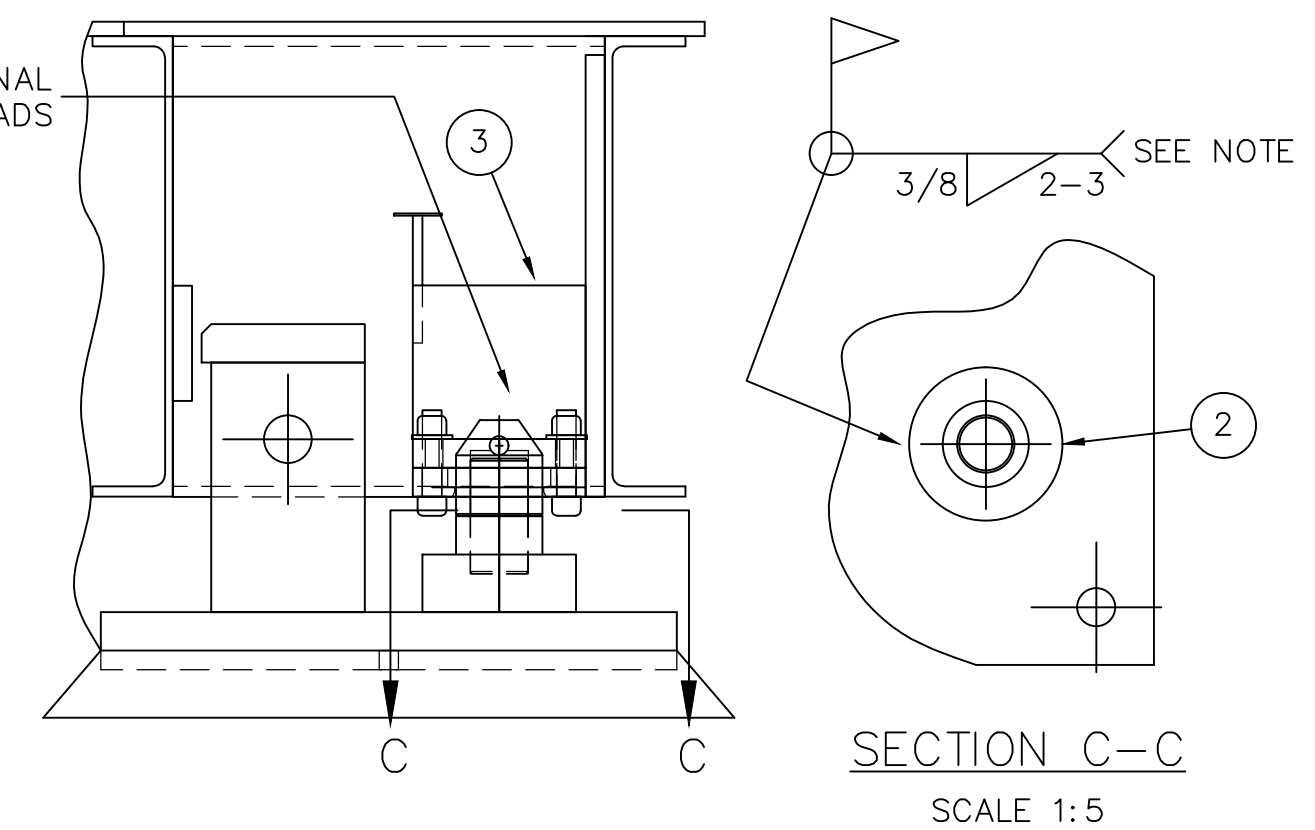

SECTION B-B
ROTATED 90°; SCALE 1:5

INSTALLATION NOTES:

- REVIEW THIS DRAWING AS WELL AS D-75429 AND D-36118 BEFORE STARTING ANY WORK.
- INSTALL THE SCALE AS PER D-36118, EXCEPT THAT CHECKING IS ON THE BASE PLATES.
- ONCE SCALE HAS BEEN SQUARED AND CENTERED IN THE PIT, ALIGN THE LOAD CELLS USING THE ALIGNMENT GAGE.
- SET THE LONGITUDINAL CHECK BOLT BUMPERS AS PER DETAIL A.
- SET THE TRANSVERSE BUMPER BLOCKS AS PER DETAIL A. MAKE SURE THE BEVEL IS ON TOP.
- POSITION THE PIN ASSEMBLIES UNDER THE CAPTURE BLOCKS AS PER SECTION B-B. CENTER THE REMOVABLE ALIGNMENT PINS IN THE CAPTURE BLOCK HOLES. YOU SHOULD BE ABLE TO PASS A 22 GAGE WIRE THROUGH THE GAPS EVERYWHERE. THE REMOVABLE ALIGNMENT PINS CAN GO DOWN THROUGH THE CAPTURE BLOCKS AND ONTO THE DOWEL PINS.
- WELD THE PIN ASSEMBLY BASES TO THE BASE PLATES AS PER SECTION C-C. IT MAY BE NECESSARY TO REMOVE THE PLATFORM FOR WELDING. SOLIDLY TACK WELD THE ALIGNMENT PIN ASSEMBLIES TO THE BASE PLATES AND PULL THE REMOVABLE PINS BEFORE REMOVING THE PLATFORM. USE ER308LSI WELDING ROD OR CONSULT LOCAL WELDING SUPPLY VENDOR, 304SS WELDED TO A36 CS.
- REPLACE THE PLATFORMS AFTER WELDING AND REMOVE THE ALIGNMENT PINS AND STORE THEM ON THE POSTS PROVIDED. SEE DECK RE-POSITIONING PROCEDURE.
- MATCH MARK ONE CORNER OF THE SCALE WITH ONE CORNER OF THE PIT. THE PLATFORM MUST GO BACK IN THE PIT THE SAME WAY EACH TIME.

MISCELLANEOUS NOTES:

- FOLLOW THE DECK RE-POSITIONING PROCEDURE WHEN SETTING THE PLATFORM BACK INTO THE PIT. FAILURE TO DO SO COULD RESULT IN THE LOSS OF THE ABILITY TO READILY RE-LOCATE THE PLATFORM ONCE REMOVED FROM THE PIT. DO NOT TRY TO FORCE THE REMOVABLE ALIGNMENT PIN ONTO THE DOWEL PIN. WIPE THEM BOTH CLEAN AND LIGHTLY GREASE THE ENGAGEMENT SURFACES BEFORE USE.
- KEEP THE THE CAPTURE BLOCK GREASED. CHECK FOR DEBRIS INSIDE THE BLOCK.
- KEEP THE DOWEL PIN AND REMOVABLE ALIGNMENT PIN CLEAN AND LIGHTLY GREASED.

USE FIVE STAR GROUT OR EQUAL

PRELIMINARY NOT FOR CONSTRUCTION. FOR ILLUSTRATION ONLY.

SEE NOTE 1 ON INSTALLATION
DRAWING # D-36118 (FOR REFERENCE)

REVISION				DATE	BY

ALL SHARP CORNERS AND EDGES TO BE BROKEN		EMERY WINSLOW SCALE COMPANY SEYMOUR, CT U.S.A TERRE HAUTE, IN.	
UNLESS OTHERWISE SPECIFIED DIMENSIONS ARE IN INCHES		MODEL H82-4012-11QC 12' X 11', 40 TON; ROADWEIGH II SP OUTLINE	
MACHINING	FABRICATION	DRAWN	DATE 12/18/19
.XX = ± .01	± .13	CHECKED	DATE
.XXX = ± .005		ACAD FILENAME:	T05567
		LAYERS USED:	ALL
SCALE 1:30	FIRST USED ON	DRAWING NO.	REV.
		D-75428	

FULL SIZE PLOT D-24X36